
Smoke and Dye Testing Summary

High Level Sewershed

Run Summary ————————————————————————————————————									
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length		
S1028-256	Smoke	8/27/2009	ADS/TM	S19QQ_017MH	Dry	Yes	650.78		

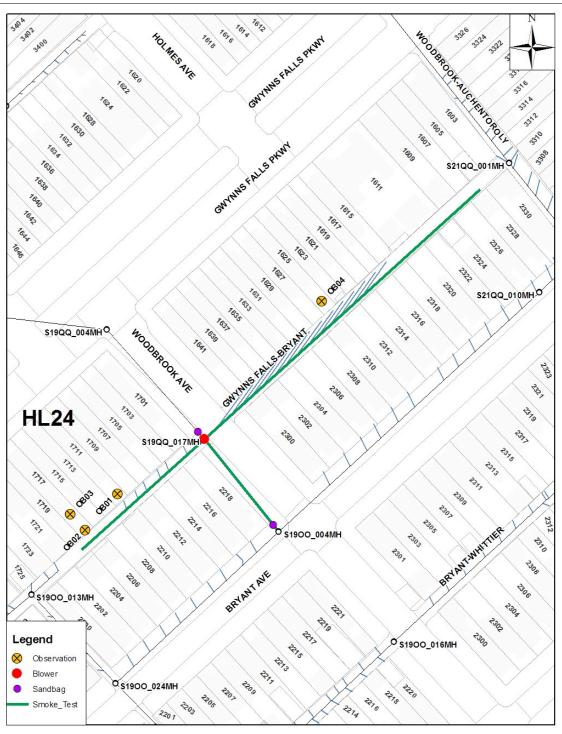

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary ————————————————————————————————————								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-256	Smoke	8/27/2009	ADS/TM	S19QQ_017MH	Dry	Yes	650.78	

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S19QQ_017G1	S19QQ_017MH	S19OO_004MH	117.985	8
S1900_041G1	S1900_041DE	S19QQ_017MH	163.914	8
S21QQ_015G1	S21QQ_015DE	S19QQ_017MH	368.884	8

Observations & Photos

Obs_ID S1028-256-OB01

Address 1711 Gwynns Falls Parkway

Status Private **Source** Cleanout

Location Paved concrete **Nearest MH** S19QQ_017MH

Comments Smoke from cleanout in paved concrete

behind house. 1711 Gwynns Falls Pkwy.



Picture \S1028-256-OB01-P01.jpg

Comments Back of house, 1711 Gwynns

Falls Pkwy.

Obs_ID S1028-256-OB02

Address 1717 Gwynns Falls Parkway

Status Private **Source** Cleanout

Location Paved concrete **Nearest MH** S19QQ_017MH

Comments Smoke from cleanout in paved concrete

behind house. 1717 Gwynns Falls Pkwy.



Picture \S1028-256-OB02-P01.jpg

Comments Back of house, 1717 Gwynns

Falls Pkwy.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary —								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-256	Smoke	8/27/2009	ADS/TM	S19QQ_017MH	Dry	Yes	650.78	

Obs_ID S1028-256-OB03

Address 1717 Gwynns Falls Parkway

Status Private

Source Service Lateral

Location Paved concrete **Nearest MH** S19QQ_017MH

Comments Smoke from service lateral under paved

concrete behind house. 1717 Gwynns Falls

Pkwy.



Picture \S1028-256-OB03-P01.jpg

Comments Back of house, 1717 Gwynns

Falls Pkwy.

Obs_ID S1028-256-OB04

Address 1625 Gwynns Falls Parkway

Status Private
Source Cleanout

Location Yard - back **Nearest MH** S19QQ_017MH

Comments Smoke from cleanout in back yard. 1625

Gwynns Falls Pkwy.



Picture \S1028-256-OB04-P01.jpg

Comments Back of house, 1625 Gwynns

Falls Pkwy.